

## **Super Fast Recovery Rectifier Diode**

#### www.jshxm.com

#### **■ Productor Character**

- Super fast switching for high efficiency.
- Low reverse leakage.
- High forward surge current capability.
- RoHs Product.


#### **■** Summarize

• SF802ACS Device optimized for ultra-low forward voltage drop to maximize efficiency in Power Supply applications.

### ■ Primary Use

 Mainly used in switching power supply, PWM pulse width modulator,inverter as a freewheeling and other electronic circuits, high-frequency rectifier diode, diode or damping diode use

### **■** Equivalent Circuit









Package:TO-252-2L SF802ACS SF802ACS-HF HF=Halogen Free

## **Absolute Maximum Ratings**

Item	Symbol	Data	Unit	
Maximal Inverted Repetitive Peak Vol	$V_{RRM}$	200	V	
Average Rectified Forward Current(Ra Wave)-50% duty cycle	I <sub>FAV</sub>	8	А	
Forward Peak Surge Current(Rated Load 8.3 Half Mssine Wave-According to JEDEC Method)		I <sub>FSM</sub>	80	А
Operating Junction Temperature	T <sub>J</sub>	<b>-</b> 40∼175	°C	
Storage Temperature	T <sub>STG</sub>	<b>-</b> 40∼175	°C	
Typical Thermal Resistance(per leg)	Package=TO-252-2L	$R_{ heta JC}$	3	°C/W

# **Electricity Character Per Diode(TJ=25°C unless otherwise specified)**


Item	Test Co	ondition	Value(min)	Value(typ)	Value(max)	Unit
$V_{B}$	TJ =25℃	IR=100uA	200	_	_	V
	TJ =25℃	VR=200V	_	_	0.01	mA
I <sub>R</sub>	TJ =125℃	VR=200V	_	_	0.05	mA
M	TJ =25℃	IF=8A	_	0.91	0.975	V
$V_{F}$	TJ =125℃	IF=8A	_	_	0.88	V
T <sub>RR</sub>	IF=0.5A,IR=1.0A,IREC=0.25A		_	_	25	nS






## **Characteristic Curves**


## The forward voltage and forward current curve

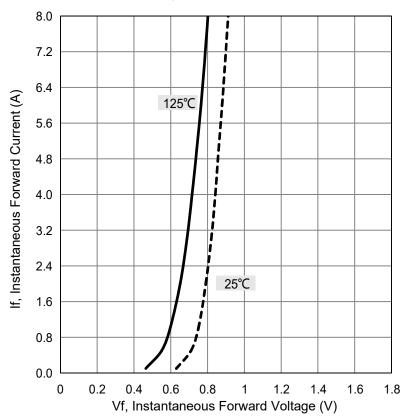

## Current derating curve, perelement

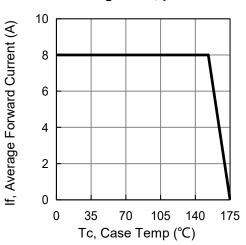


## The reverse leak current and the reverse voltage (single-device) curve.

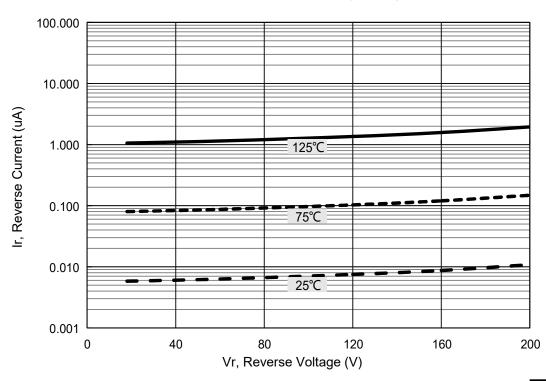






# **Package Outline Dimensions & Suggested Solder Pad Layout**

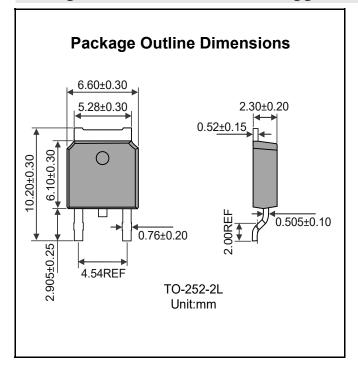

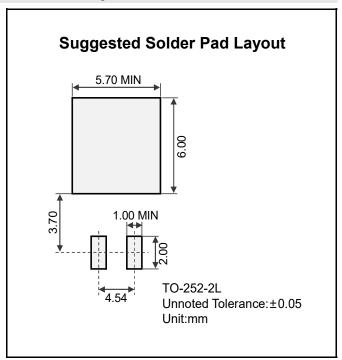

# **Marking Information**



- "MHCHXM"= Product Logo
- "Marking Code" = The Following
- "XXXX"= Date Code Marking

Marking Code	Part Number		
SF802ACS	SF802ACS		
SF0UZACS	SF802ACS-HF		






www.jshxm.com


# **Packing Information**

Packaging	Part Number	Quantity(pcs)	Size(mm)
Tube	Tube	80	L540×W20×H5
	Inner Box	4000	L570×W115×H55
	Outer Box	20000	L595×W320×H135
Reel	Reel	3000	Ф330×THK17
	Inner Box	3000	L350×W340×H25
	Outer Box	30000	L355×W300×H360


## Packaging:Tube

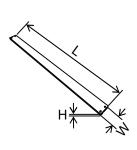



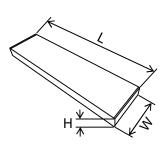


Tube Inner Box

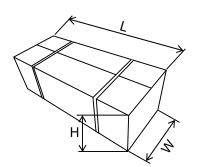


**Tube Outer Box** 


## Packaging:Reel

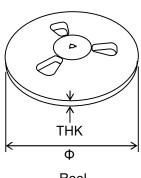

Reel

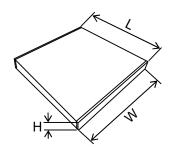

Reel Inner Box

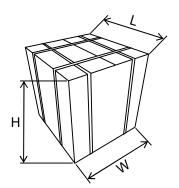

Reel Outer Box



www.jshxm.com

### **Notes**

### **Lead Forming**

1. During lead frame bending, the lead frame should be bent at a distance more than 3mm from bottom of the epoxy.

Note: The lead frame must be secured and do not touch the epoxy before bending to avoid damage to the transistor. In addition, when using a mold for a large number of lead molding, the structure of the fixed lead must be set, and it should be noted that the lead pressure rod structure cannot exert pressure on the epoxy resin body.

2. Do not bend the lead repeatedly. Do not bend the lead outward

### Heat sink mounting

For power devices, in order to reduce junction temperature, heat dissipation blocks are usually used to disperse heat to the outside, and semiconductor power devices installed on the heat dissipation blocks can effectively dissipate heat without losing the reliability of the semiconductor, so the following matters should be noted when using:

1. Pay attention to the selection of silicone cream In order to improve the thermal conductivity and heat dissipation effect of the device and the heat dissipation block, generally apply a thin layer of silicone grease evenly on the contact surface of the device and the heat dissipation block. Choose a silicone grease with low oil separation degree. Do not overapply it, otherwise it will attach too much stress to the resin.

#### 2. Optimum torque is required

When using the fastening torque, pay attention not to use too much torque, so as not to damage the epoxy resin body, pay attention to the smooth cooling block body, no file chips and other foreign bodies between the transistor and the cooling block, pay attention to the selection of screws, nuts, gaskets and washers, so as not to cause damage to the transistor due to improper selection.

#### Soldering

- 1. Pay special attention to welding. When welding, the distance between the solder joint and the epoxy ball should be greater than 3mm, and it is recommended to weld it outside the tie rod base.
- 2. Avoid applying any pressure to the lead frame while the transistor is at high temperatures, especially when welding. Dip welding and manual welding should not be done more than once

#### Notes:

For specific precautions, please refer to our company's relevant technical documents or visit our official website at <a href="http://www.jshxm.com">http://www.jshxm.com</a>



### **DISCLAIMER**

- 1. Above specification may be changed without notice. MHCHXM will reserve authority on material change for above specification.
- 2. The graphs shown in this datasheet are representing typical data only and do not show guaranteed
- 3. When using this product, please observe the absolute maximum ratings and the instructions for use outlined in these specification sheets. MHCHXM assumes no responsibility for any damage resulting from use of the product which does not comply with the absolute maximum ratings and the instructions included in these specification sheets.
- 4. These specification sheets include materials protected under copyright of MHCHXM. Reproduction in any form is prohibited without the specific consent of MHCHXM.
- 5. This product is not intended to be used for military, aircraft, automotive, medical, life sustaining or life saving applications or any other application which can result in human injury or death. Please contact authorized MHCHXM sales agent for special application request.
- Statements regarding the suitability of products for certain types of applications are based on MHCHXM's knowledge of typical requirements that are often placed on MHCHXM products in generic applications. Such statements are not binding statements about the suitability of products for a particular application. It is the customer's responsibility to validate that a particular product with the properties described in the product specification is suitable for use in a particular application. Parameters provided in datasheets and/or specifications may vary in different applications and performance may vary over time. All operating parameters, including typical parameters, must be validated for each customer application by the customer's technical experts. Product specifications do not expand or otherwise modify MHCHXM's terms and conditions of purchase, including but not limited to the warranty expressed therein.
- 7. This publication supersedes & replaces all information previously supplied. For additional application information, please visit our website http://www.jshxm.com, or consult your nearest MHCHXM's sales office for further assistance.

